# TS 3-14 03313(R) MODIFICATION OF AUTOMATIC TRANSMISSION CONTROLLER Article Text

1992 Suzuki Swift For Xeon

Copyright © 1998 Mitchell Repair Information Company, LLC Tuesday, December 02, 2003 07:03PM

### **ARTICLE BEGINNING**

TECHNICAL SERVICE BULLETIN

# MODIFICATION OF AUTOMATIC TRANSMISSION (A/T) CONTROLLER

Model June 1992 and later Suzuki (except GT)

Division Automotive Category Technical Section Drivetrain Bulletin No. TS 3-14 033

ulletin No. TS 3-14 03313(R)

CONDITION: Harsh shifting

CAUSE: Programming of A/T controller

CORRECTION: Replace A/T controller.

REVISION: Modification does not include GT.

This bulletin is to inform you of the modification of the A/T controller which has been carried out since June 1992 production. Due to the modification of the AT controller, the A/T shift diagram has also been changed. See Figs. 1 and 2.

also been changed. See Figs. 1 and 2.

To identify the early or the late type AT controller, check the part number on the name plate as shown in Fig. 3.

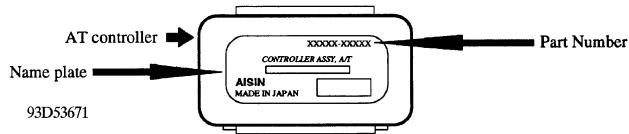


Fig. 1: A/T Controller Name Plate


## PARTS INFORMATION TABLE

Part Name	Early Part No.	Late Part No.	#	Supply of Spare Parts	Interchange- ability
A/T controller	388861E00	388861E40	1	Late only	Early<—>Late


#### EFFECTIVE VIN NUMBERS

JS2AA355 P5100596- J52AH355\_P5100201-J52AC355 P5100706- J52AH35S\_P5100201-JS2AE35S P5100539- 2S2AA35S\_P6600001-2S2AC35S P6600001-



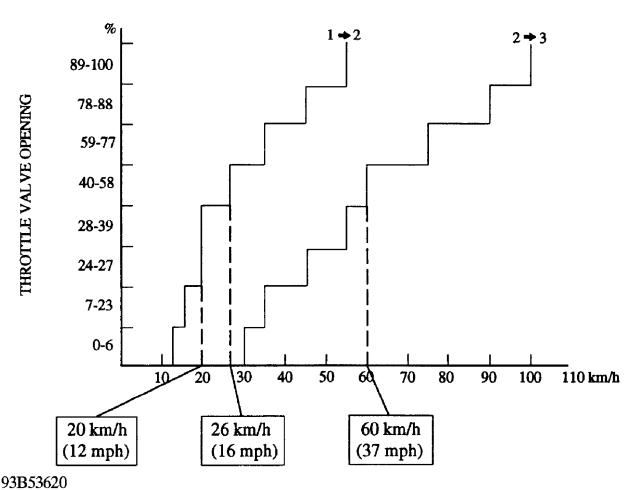

 $93B53620 \\ \text{Fig. 2: Original A/T Shift Diagram}$ 

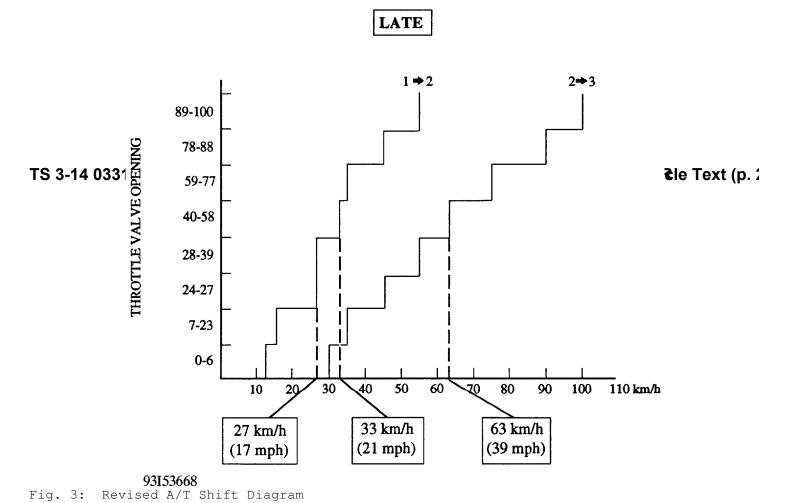

## **END OF ARTICLE**